Manual
F4/FE

DIAZ | SUNPROTECTION

Placement of the clips on the profile

50 mm

600 mm

600 mm

50 mm

Don't place
any brackets here

clip

profile stabilizer
(position should be under or
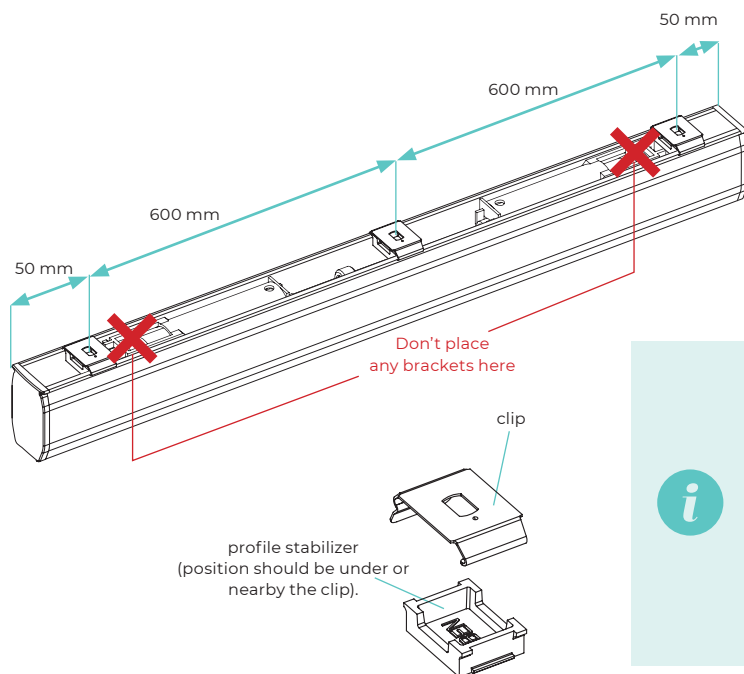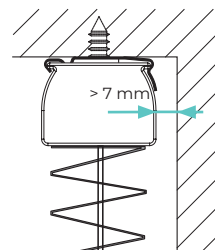nearby the clip).

Mount the clips 50 mm from the end
of the headrail, and with a distance
of max. 600 mm.

⚠️ Attention! Make sure the brackets
are not fixed on top of the spools
in the headrail.

ⓘ It is recommended to mount
the clip with the flap forward
(into the room). The clip can
only be mounted with the flap
toward the window
or the pane respectively,
in case the distance to the rail
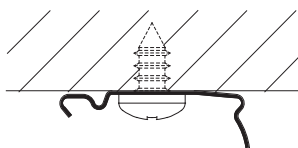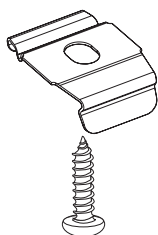is min. 7mm.

> 7 mm

Mounting of the pleated blind on the ceiling
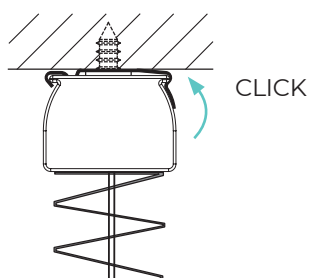
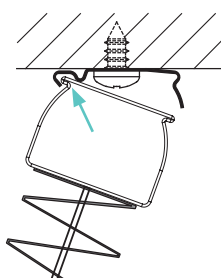**1** Mount the clips on the ceiling with a screw

DIN 7982 ⌀ 3,9 x 13 mm

DIN 7981 ⌀ 2,9 x 9,5 mm

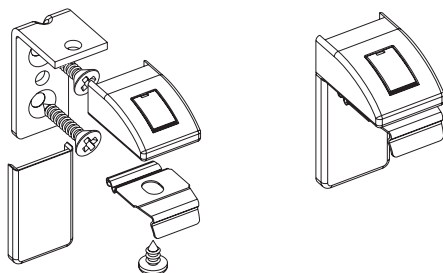**2** Place the profile in the back edge of the clip and push the front of the profile upwards (untill it clicks).

CLICK

Mounting of the pleated blind on the wall

1   Mount the bracket on the wall and attach the clip.

DIN 7982 ø 3,9 x 13 mm

DIN 7981 ø 2,9 x 9,5 mm

Alternative mounting

2   Place the profile in the back edge of the clip and push the front of the profile upwards (untill it clicks).
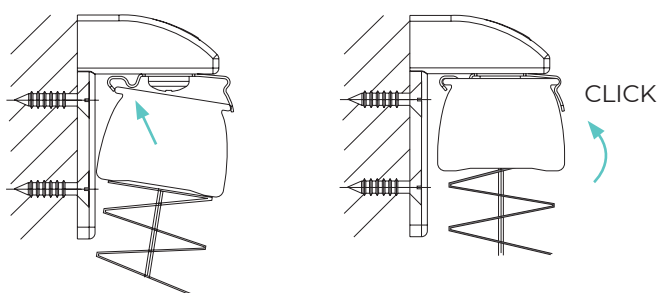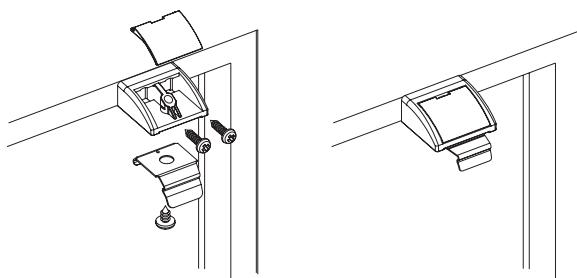
CLICK

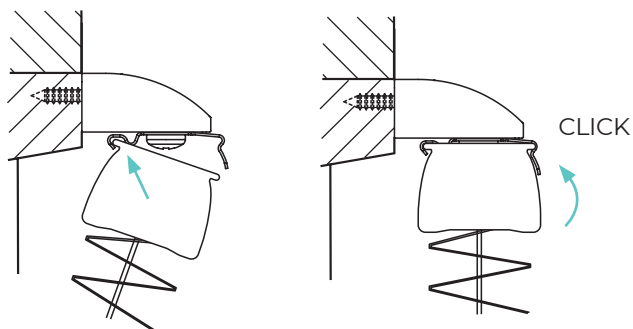## Mounting of the pleated blind with glazing bead support

1   Install the support with moulding locking strip and attach the clip.

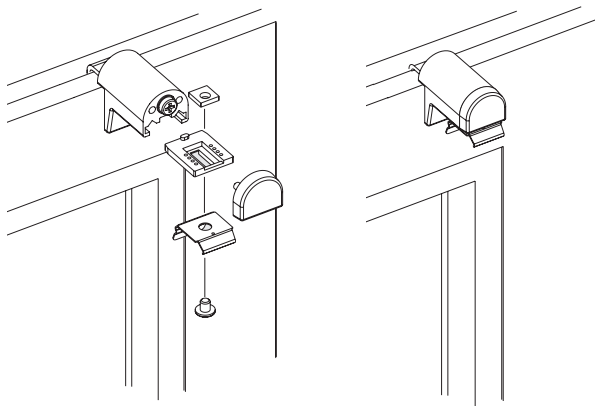DIN 7982 ø 3,9 x 13 mm

DIN 7981 ø 2,9 x 9,5 mm

2   Place the profile in the back edge of the clip and push the front of the profile upwards (untill it clicks).
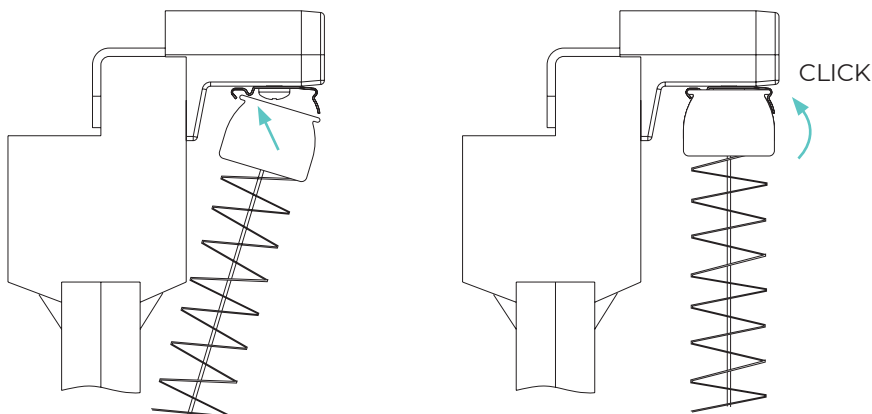
CLICK

Mounting the pleated blind with block holder

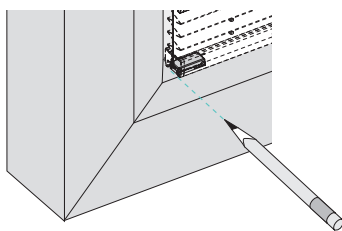**1** Install the block holder and attach the clip.

2 Place the profile in the back edge of the clip and push the front of the profile upwards (untill it clicks).
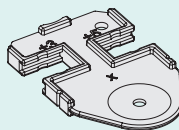
CLICK

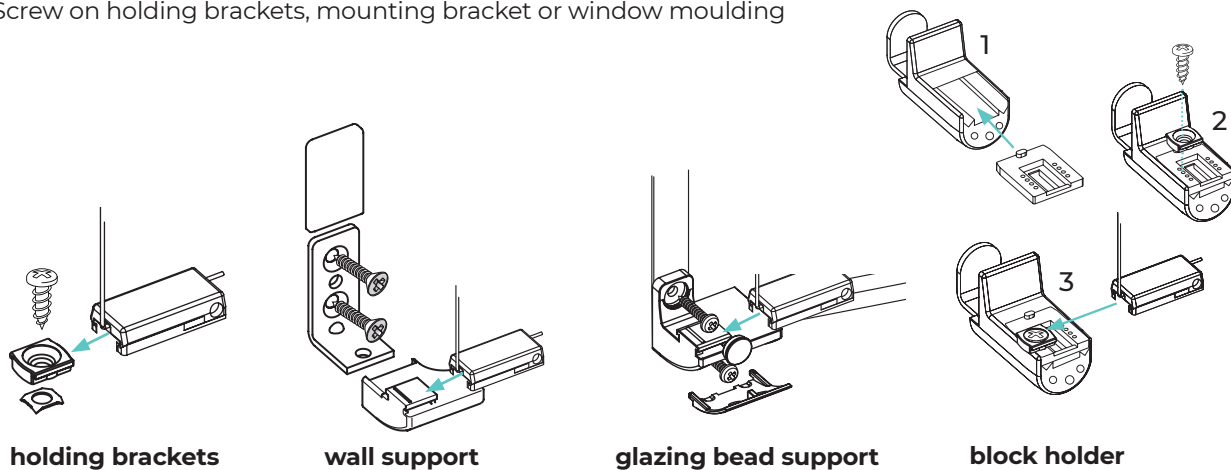## Mounting of tension cord bracket

1 Let down the blind and mark the position for the clamping shoe.
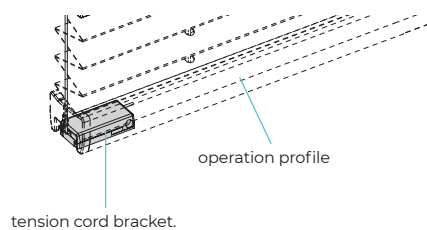
i You can also use the fixing template (green) to mark the position. (see seperate sheet)
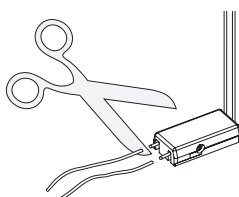
2 Screw on holding brackets, mounting bracket or window moulding

holding brackets　　**wall support**　　**glazing bead support**　　**block holder**

3 Check the operation of the blind.

operation profile

tension cord bracket.

4 Cut off the excess cord ends

⚠ Adjustment of the cord tension must be uniform and may only be made by a professional.